



October 11, 2022
Diane Czarnecki
Industrial Hygienist
Facilities Management Division
GSA Public Buildings Service – Heartland Region
2300 Main Street
Kansas City, MO 64108

Re: Goodfellow Federal Center – Bldg. 107 Drinking Water Sampling
Project No. 121244

Dear Ms. Czarnecki:

Thank you for the opportunity to provide the General Services Administration (GSA) with the above referenced environmental sampling activities. The following is our report.

INTRODUCTION

As requested, Burns & McDonnell conducted drinking water sampling and testing for the presence of lead and copper at Building 107 of the Goodfellow Federal Center located at 4300 Goodfellow Boulevard in St. Louis, Missouri. Sampling was completed in response to the ongoing environmental condition assessment at the Goodfellow Federal Center which is documented at the Goodfellow Federal Center Reading Room located at <https://www.gsa.gov/portal/content/212361>.

Drinking water sampling was conducted to determine the current levels of lead and copper in representative sources throughout the complex. Drinking water sampling at Bldg. 107 was conducted on September 12, 2022 by Ashley Anstaett of Burns & McDonnell.

METHODOLOGY

The sampling methodology used during this investigation was developed in general accordance with the United States Environmental Protection Agency's (EPA) "Quick Guide to Drinking Water Sample Collection – Second Edition" developed by the EPA Region 8 in September 2016.

Samples were collected as first draw samples in accordance with the Lead and Copper Rule (40 CFR Part 141 Subpart I). First draw samples represent 'worst case' conditions with water that has been stationary within the plumbing systems for a minimum of six hours. The samples were collected in individually labeled 1000 milliliter (mL) plastic bottles capped with Teflon septa lined screw caps. The bottles were filled to the shoulder with water from the sample source. The samples were then placed in a cooler for safe transport. Each sample was acidified at the laboratory as needed.

Diane Czarnecki
 Facilities Management Division
 October 11, 2022
 Page 2

Drinking water sampling for the presence of lead and copper was conducted at four (4) distinct locations within Building 107. A total of five (5) samples were obtained including duplicate samples. After each drinking water sample was collected, Burns & McDonnell filled a separate sample cup with approximately 2 inches of water. Burns & McDonnell placed an Oakton EcoTestr pH and temperature meter into the sample cup. After readings stabilized, Burns & McDonnell recorded the readings for pH (the acidity or basicity of an aqueous solution) and the temperature (in degrees Celsius) on site specific sample logs.

Drinking water samples were submitted to Eurofins-Eaton Analytical in South Bend, IN for analyses of lead and copper. Eurofins-Eaton Analytical is certified by the State of Missouri Department of Natural Resources (MDNR) as an approved drinking water laboratory. Eurofins-Eaton Analytical’s Missouri Certification number is 880.

The drinking water samples were collected using media supplied by Eurofins-Eaton Analytical. Lead and Copper samples were collected and analyzed in accordance with EPA Method 200.8.

RESULTS AND DISCUSSION

The results for the subject testing are summarized in the table below.

Analysis	Lowest Concentration^(a)	Highest Concentration^(a)	Action Level^(b)
Lead	<0.5 µg/L	0.9 µg/L	15 µg/L
Copper	10 µg/L	17 µg/L	1300 µg/L

Notes:

- (a) Samples with a “<” sign indicate that the results were below the reportable limit.
- (b) As per EPA Lead and Copper Rule (40 CFR Part 141 Subpart I).
- (c) µg/L – micrograms per liter

No samples resulted in lead or copper concentrations over the action levels.

A summary table of all sampling results by location is included in Appendix A. The complete laboratory report for the drinking water sampling from Eurofins-Eaton Analytical is attached in Appendix B.

pH

Normal pH levels for drinking water are between 6.0 to 8.5. Water with a pH < 6.5 is considered acidic, soft, and corrosive. Acidic water may contain metal ions, may cause premature damage to metal piping, and increases the likelihood of leaching. Water with a pH > 8.5 is considered alkaline or basic and can indicate that the water is hard. Hard water does not pose a health risk

Diane Czarnecki
Facilities Management Division
October 11, 2022
Page 3

but can cause aesthetic problems. These problems include an alkali taste, the formation of scale deposits, and difficulty in getting soaps and detergents to lather.

Recorded pH levels in Building 107 ranged from 7.20 to 10.00 indicating the drinking water is slightly alkaline.

LIMITATIONS

The scope of this assessment was limited in nature. Burns & McDonnell collected samples from a select number of drinking water sources in an effort to minimize cost while providing a general overview of the drinking water quality at the site. Sample locations do not encompass every drinking water source at the Site. Additionally, samples were only analyzed for a select number of potential contaminants likely to affect the drinking water quality at the site. Burns & McDonnell is not responsible for potential contaminants not identified in this report.

Burns & McDonnell appreciates the opportunity to work with the GSA on this project. Please contact us if you have any questions regarding this report or if we may be of any additional service.

Sincerely,

(b) (6)



Matt Shanahan, CHMM
Project Manager

Attachments:

- Appendix A - Results Summary by Location
- Appendix B - Water Sample Laboratory Report

APPENDIX A – RESULTS SUMMARY BY LOCATION

Appendix A

Results Summary by Location

Sample Number	Location	pH	Temp (°C)	Water Source	Analyte	Result	Units	Above / Below	AL
107-DW-01	1st floor, room 106, kitchen	9.8	25.2	Sink	Copper	11	µg/L	Below	1300
107-DW-01	1st floor, room 106, kitchen	9.8	25.2	Sink	Lead	0.92	µg/L	Below	15
107-DW-02	Duplicate of 107-DW-01	9.8	25.2	Sink D	Copper	13	µg/L	Below	1300
107-DW-02	Duplicate of 107-DW-01	9.8	25.2	Sink D	Lead	0.80	µg/L	Below	15
107-DW-03	1st floor, south lobby, bottle filler	9.9	19.0	DF	Copper	13	µg/L	Below	1300
107-DW-03	1st floor, south lobby, bottle filler	9.9	19.0	DF	Lead	< 0.50	µg/L	Below	15
107-DW-04	1st floor, south lobby	10.0	18.0	DF	Copper	10	µg/L	Below	1300
107-DW-04	1st floor, south lobby	10.0	18.0	DF	Lead	< 0.50	µg/L	Below	15
107-DW-05	1st floor, room 106, refrigerator	7.2	24.7	Refrig.	Copper	17	µg/L	Below	1300
107-DW-05	1st floor, room 106, refrigerator	7.2	24.7	Refrig.	Lead	< 0.50	µg/L	Below	15

Notes:

DF - Drinking Fountain

D - Duplicate

AL - Action Level

µg/L - micrograms per liter

APPENDIX B – WATER SAMPLE LABORATORY REPORT

ANALYTICAL REPORT

Eurofins Eaton South Bend
110 S Hill Street
South Bend, IN 46617
Tel: (574)233-4777

Laboratory Job ID: 810-37077-1
Client Project/Site: Burns & McDonnell

For:
Burns & McDonnell
425 South Woods Mill Road
Chesterfield, Missouri 63017

Attn: Mr. Matt Shanahan

(b) (6)

Authorized for release by:
9/20/2022 7:34:57 AM

Amanda Scott, Project Manager
(574)233-4777
Amanda.Scott@et.eurofinsus.com

LINKS

Review your project
results through



Have a Question?



Visit us at:

www.eurofinsus.com/Env

This report has been electronically signed and authorized by the signatory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

Results relate only to the items tested and the sample(s) as received by the laboratory.



Table of Contents

Cover Page	1
Table of Contents	2
Definitions/Glossary	3
Case Narrative	4
Client Sample Results	5
Lab Chronicle	6
Certification Summary	7
Method Summary	8
Sample Summary	9
Chain of Custody	10
Receipt Checklists	11

Definitions/Glossary

Client: Burns & McDonnell
Project/Site: Burns & McDonnell

Job ID: 810-37077-1

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
▫	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: Burns & McDonnell
Project/Site: Burns & McDonnell

Job ID: 810-37077-1

Job ID: 810-37077-1

Laboratory: Eurofins Eaton South Bend

Narrative

Job Narrative
810-37077-1

Receipt

The samples were received on 9/13/2022 10:00 AM. Unless otherwise noted below, the samples arrived in good condition, and, where required, properly preserved and on ice.

Metals

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.



Client Sample Results

Client: Burns & McDonnell
 Project/Site: Burns & McDonnell

Job ID: 810-37077-1

Client Sample ID: 107-DW-01

Lab Sample ID: 810-37077-1

Date Collected: 09/12/22 04:53

Matrix: Drinking Water

Date Received: 09/13/22 10:00

Method: 200.8 - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Lead	0.92		0.50	ug/L			09/19/22 18:16	1
Copper	11		1.0	ug/L			09/19/22 18:16	1

Client Sample ID: 107-DW-02

Lab Sample ID: 810-37077-2

Date Collected: 09/12/22 04:53

Matrix: Drinking Water

Date Received: 09/13/22 10:00

Method: 200.8 - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Lead	0.80		0.50	ug/L			09/19/22 18:18	1
Copper	13		1.0	ug/L			09/19/22 18:18	1

Client Sample ID: 107-DW-03

Lab Sample ID: 810-37077-3

Date Collected: 09/12/22 04:57

Matrix: Drinking Water

Date Received: 09/13/22 10:00

Method: 200.8 - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Lead	<0.50		0.50	ug/L			09/19/22 18:21	1
Copper	13		1.0	ug/L			09/19/22 18:21	1

Client Sample ID: 107-DW-04

Lab Sample ID: 810-37077-4

Date Collected: 09/12/22 05:00

Matrix: Drinking Water

Date Received: 09/13/22 10:00

Method: 200.8 - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Lead	<0.50		0.50	ug/L			09/19/22 18:24	1
Copper	10		1.0	ug/L			09/19/22 18:24	1

Client Sample ID: 107-DW-05

Lab Sample ID: 810-37077-5

Date Collected: 09/12/22 05:05

Matrix: Drinking Water

Date Received: 09/13/22 10:00

Method: 200.8 - Metals (ICP/MS)

Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Lead	<0.50		0.50	ug/L			09/19/22 19:20	1
Copper	17		1.0	ug/L			09/19/22 19:20	1

Lab Chronicle

Client: Burns & McDonnell
Project/Site: Burns & McDonnell

Job ID: 810-37077-1

Client Sample ID: 107-DW-01

Date Collected: 09/12/22 04:53

Date Received: 09/13/22 10:00

Lab Sample ID: 810-37077-1

Matrix: Drinking Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	200.8		1	32266	NB	EA SB	09/19/22 18:16

Client Sample ID: 107-DW-02

Date Collected: 09/12/22 04:53

Date Received: 09/13/22 10:00

Lab Sample ID: 810-37077-2

Matrix: Drinking Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	200.8		1	32266	NB	EA SB	09/19/22 18:18

Client Sample ID: 107-DW-03

Date Collected: 09/12/22 04:57

Date Received: 09/13/22 10:00

Lab Sample ID: 810-37077-3

Matrix: Drinking Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	200.8		1	32266	NB	EA SB	09/19/22 18:21

Client Sample ID: 107-DW-04

Date Collected: 09/12/22 05:00

Date Received: 09/13/22 10:00

Lab Sample ID: 810-37077-4

Matrix: Drinking Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	200.8		1	32266	NB	EA SB	09/19/22 18:24

Client Sample ID: 107-DW-05

Date Collected: 09/12/22 05:05

Date Received: 09/13/22 10:00

Lab Sample ID: 810-37077-5

Matrix: Drinking Water

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	200.8		1	32266	NB	EA SB	09/19/22 19:20

Laboratory References:

EA SB = Eurofins Eaton South Bend, 110 S Hill Street, South Bend, IN 46617, TEL (574)233-4777

Accreditation/Certification Summary

Client: Burns & McDonnell
Project/Site: Burns & McDonnell

Job ID: 810-37077-1

Laboratory: Eurofins Eaton South Bend

The accreditations/certifications listed below are applicable to this report.

Authority	Program	Identification Number	Expiration Date
Missouri	State	880	09-30-24



Method Summary

Client: Burns & McDonnell
Project/Site: Burns & McDonnell

Job ID: 810-37077-1

Method	Method Description	Protocol	Laboratory
200.8	Metals (ICP/MS)	EPA	EA SB

Protocol References:

EPA = US Environmental Protection Agency

Laboratory References:

EA SB = Eurofins Eaton South Bend, 110 S Hill Street, South Bend, IN 46617, TEL (574)233-4777



Sample Summary

Client: Burns & McDonnell
Project/Site: Burns & McDonnell

Job ID: 810-37077-1


Lab Sample ID	Client Sample ID	Matrix	Collected	Received
810-37077-1	107-DW-01	Drinking Water	09/12/22 04:53	09/13/22 10:00
810-37077-2	107-DW-02	Drinking Water	09/12/22 04:53	09/13/22 10:00
810-37077-3	107-DW-03	Drinking Water	09/12/22 04:57	09/13/22 10:00
810-37077-4	107-DW-04	Drinking Water	09/12/22 05:00	09/13/22 10:00
810-37077-5	107-DW-05	Drinking Water	09/12/22 05:05	09/13/22 10:00





Eaton Analytical

110 S. Hill
South Ben
T: 1.800.3
F: 1.574.2

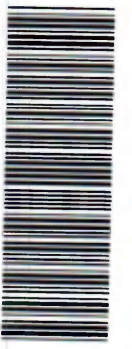

810-37077 Chain of Custody

CHAIN OF CUSTODY RECORD
Shaded area for EEA use only

Page 1 of 1

REPORT TO: *raputcher@humsmed.com* SAMPLER (Signature): [Redacted] PWS ID #: M0 STATE (sample origin): M0 PROJECT NAME: GFC PO#: 121244

BILL TO: *Saver* COMPLIANCE MONITORING: Yes No POPULATION SERVED: SOURCE WATER: TEST NAME: *Lead + Copper*

LAB NUMBER	COLLECTION		SAMPLING SITE	TEST NAME	PH accp label?	Residual Chlorine (P/A)	CHLORINATED		# OF CONTAINERS	MATRIX CODE	TURN-AROUND TIME
	DATE	TIME					YES	NO			
1	9/19/22	0453	107-DW-01						1	DW SW	
2		0453	107-DW-02						1	DW SW	
3		0457	107-DW-03						1	DW SW	
4		0500	107-DW-04						1	DW SW	
5		0505	107-DW-05						1	DW SW	
6											
7											
8											
9											
10											
11											
12											
13											
14											

RELINQUISHED BY (Signature): [Redacted] DATE: 9/19/22 TIME: 4:30 AM RECEIVED BY (Signature): [Redacted] DATE: 9/13/22 TIME: 10:22 AM

RELINQUISHED BY (Signature): [Redacted] DATE: 9/19/22 TIME: 4:30 AM RECEIVED FOR LABORATORY BY: [Redacted] DATE: 9/13/22 TIME: 10:22 AM

MATRIX CODES: DW-DRINKING WATER RW-REAGENT WATER GW- GROUND WATER EW-ENCLOSURE WATER SW- SURFACE WATER PW-POOL WATER WW-WASTE WATER

TURN-AROUND TIME (TAT) - **STANDARD**
 SW = Standard Written (15 working days) 0% RV* = Rush Verbal (5 working days)
 50% RV* = Rush Written (5 working days) 75%
 *Please call, expedited service not available for all testing

LAB COMMENTS: Lead: VeriBlue X Ambient

CONDITIONS UPON RECEIPT (check one)
 Lead: VeriBlue X Ambient

100% CALL
 125% CALL
 100% CALL

Sample analysis will be provided according to the standard EEA Water Services Terms, which are available upon request. Any other terms proposed by Customer are deemed material alterations and are rejected unless expressly agreed to in writing by EEA.

Login Sample Receipt Checklist

Client: Burns & McDonnell

Job Number: 810-37077-1

Login Number: 37077

List Source: Eurofins Eaton South Bend

List Number: 1

Creator: DePriest, Kellie

Question	Answer	Comment
The cooler's custody seal, if present, is intact.	True	
Sample custody seals, if present, are intact.	True	
Samples were received on ice.	False	Thermal preservation not required.
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	False	Thermal preservation not required.
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is <6mm (1/4").	True	
Samples do not require splitting or compositing.	True	
Container provided by EEA	True	

